PRULITE.COM 213.746.0360


X3 / X7 (HARD CEILING)


PARTS LIST


VARIABLE	Top Over Head Support Bracket	1
872070	P4000-SMR Over Head Joiner Bracket	1
VARIABLE	Bottom Over Head Bracket	1
79741	P4000-SMR 4" Angled Leg	4
100-00230-14	1/4-20 x 31/2" RD. HD. MS. Screw (Non-tilt)	4
100-00283-14	1/4-20 x 5" RD. HD. MS. Screw (Tilt)	4
VARIABLE	P4000-SMR Trim Ring Assembly	1


100-00034-14	1/4-20 x 21/2" RD. HD. MS. Screw (Trim)	4
100-00141-14	#8 x ¼″ HWH SLT-SMS Type B Screw	10
100-00255-14	1/4-20 Keps Hex Nut	16
100-00114-14	1/4-20 x 3/4" Truss HD. Machine Screw	12
100-00012-14	1/4-20 Speed Nut	4
VARIABLE	P4000-SMR Top Cover Plate	4
	Lens Removal Tool	

HARD CEILING FRAME

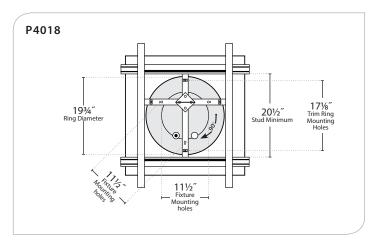

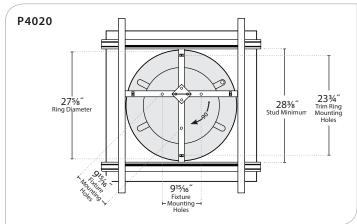

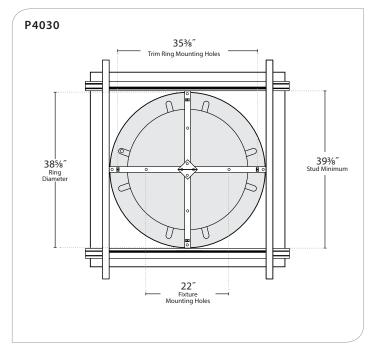

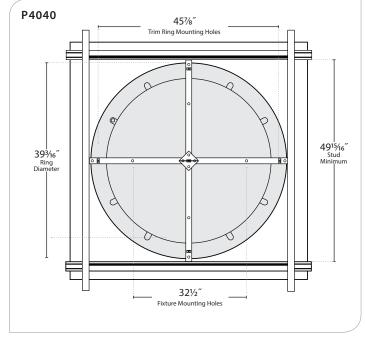






X3 / X7 (HARD CEILING)




HARD CEILING CLEARANCE CUTOUT

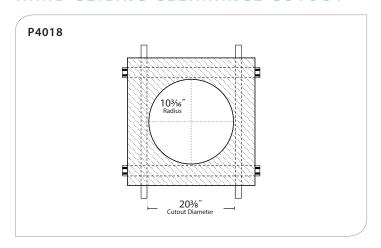

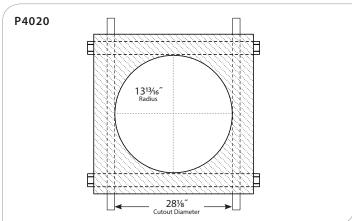

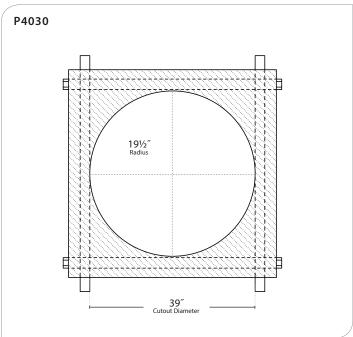

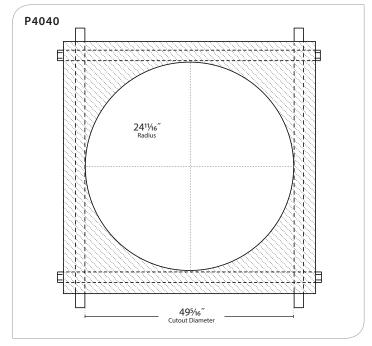



X3 / X7 (HARD CEILING)




OVERHEAD SUPPORT BRACKETS

NOTES:

- Before assembly of overhead mounting support brackets see page 1 for trim ring mounting hole dimensions.
- Do not use trim ring mounting holes for attaching 4" angled leg. Doing so will obstruct trim ring holes when mounting trim ring to ceiling.
 (See figure 1).
- 1. Assemble top overhead bracket with bottom overhead bracket. Be sure parts are secured at 90° right angle for proper alignment with trim ring and holes.
- 2. Connect 4" angled legs to each end of mounting bracket assembly. Be sure trim ring mounting holes are unobstructed.

Top Overhead Support Bracket		Bottom Overhead Support Bracket			
Part No.	Model	Length	Part No.	Model	Length
87209	P4018	225%"	87208	P4018	225/8"
87659	P4020	28″	87658	P4020	28″
87663	P4030	39″	87662	P4030	39″
87683	P4040	491/2"	87682	P4040	491/2"

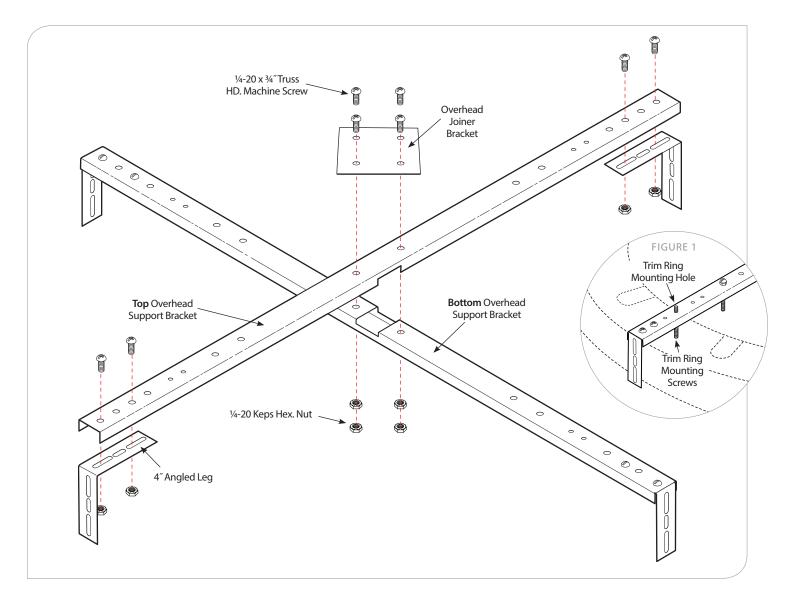




X3 / X7 (HARD CEILING)





OVERHEAD MOUNTING BRACKET ASSEMBLY

- 1. Secure overhead mounting bracket assembly to inner studs wall with self drilling screws (by others).
- 2. Adjust depth to dimensions required for SMR-4 or SMR-7.

NOTE: See dimension B for clearance required from bottom of ceiling surface to bottom of SMR overhead mounting bracket assembly.

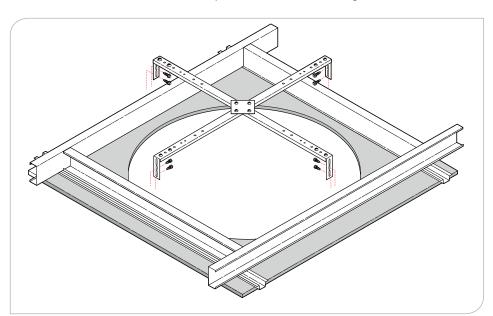

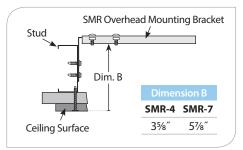

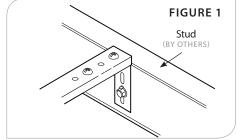


INSTALL FIXTURE MOUNTING SCREWS


NOTE: See page 1 for fixture mounting hole dimensions.

- 1. Locate matching hole pattern on support bracket assembly.
- 2. Attach ¼-20 x 3½ "RD. HD. MS (non-tilt) or ¼-20 x 5 "RD. HD. MS. screw (tilt) and ¼-20 keps hex nut.
- 3. Attach screw elevation with top lock nut and lock in place with lower lock nut.

STRUCTURAL SUPPORT

1. Secure overhead bracket assembly to structural member with adequate support wire or threaded rod.

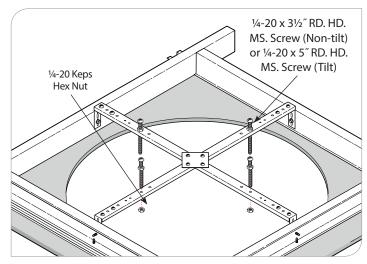

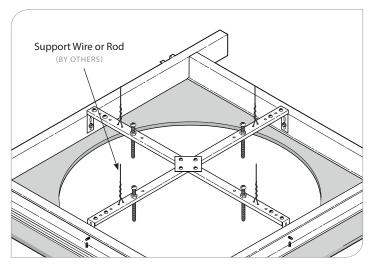




PRULITE COM 213 746 0360



TRIM RING ASSEMBLY

NOTE

- P4020, P4030 and P4040 require two piece cover installation.
- P4018 requires single cover install.
- 1. Align 5% diameter hole on trim ring assembly, with mating holes on mounting bracket assembly. (See page 1 for trim ring mounting hole dimensions).
- 2. Fasten in place with 1/4-20 x 21/2" screws and 1/4-20 speed nut.
- 3. Verify power feed K.O. located of body assembly.
- 4. Cut away pre-punched top cover area aligned with body assembly K.O. for flex conduit attachment (by others) to body assembly.
- 5. Install top cover plates with #8 x ¼" SM type B screws.

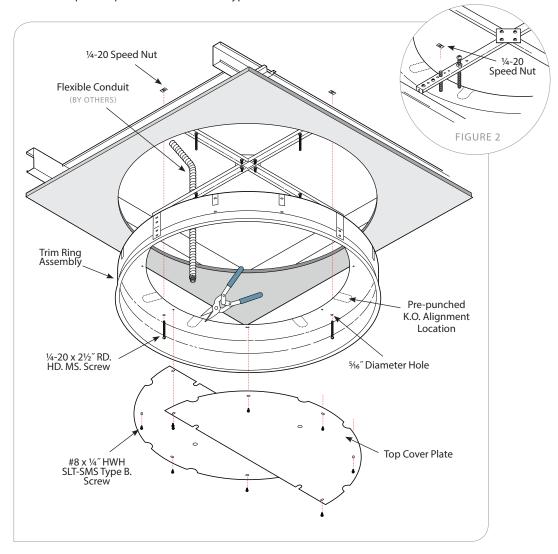




PRULITE.COM 213.746.0360



X3 / X7 (HARD CEILING) MOUNTING BRACKET ASSEMBLY

1. Remove power access K.O. on body.

2. Attach flexible conduit (by others) and lift body onto $\frac{1}{4}$ -20 x $3\frac{1}{2}$ screws and secure in place with $\frac{1}{4}$ -20 keps nut.

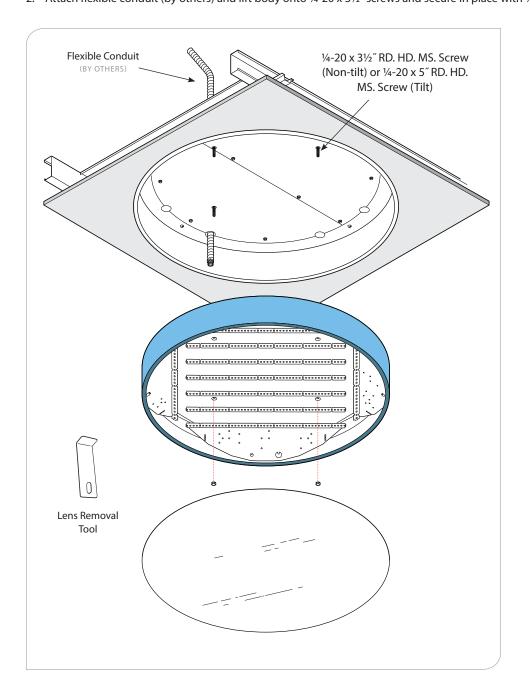




PRIJLITE COM 213 746 0360



TRIM RING ASSEMBLY

NOTE

- P4020, P4030 and P4040 require two piece cover installation.
- P4018 requires single cover install.
- 1. Align 5%" diameter hole on trim ring assembly, with mating holes on mounting bracket assembly. (See page 1 for trim ring mounting hole dimensions).
- 2. Fasten in place with 1/4-20 x 21/2" screws and 1/4-20 speed nut.
- 3. Verify power feed K.O. located of body assembly.
- 4. Cut away pre-punched top cover area aligned with body assembly K.O. for flex conduit attachment (by others) to body assembly.
- 5. Install top cover plates with #8 x ¼ SM type B screws.

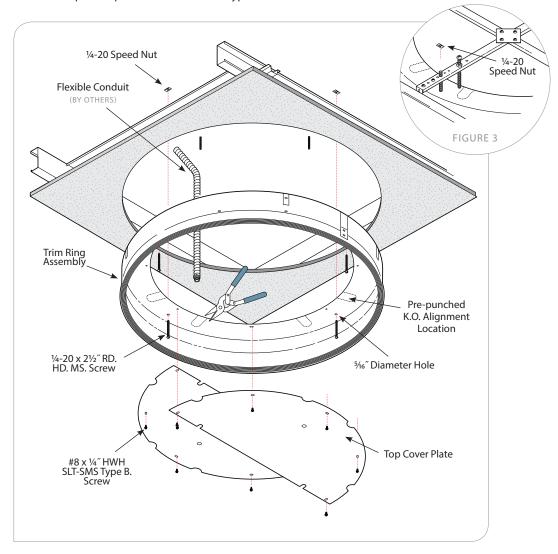



PRULITE.COM 213.746.0360

INSTALLATION INSTRUCTIONS

X3 / X7 (HARD CEILING)

MOUNTING BRACKET ASSEMBLY

- 1. Remove power access K.O. on body.
- 2. Attach flexible conduit (by others) and lift body onto 1/4-20 x 31/2" screws and secure in place with 1/4-20 keps nut.

